



**BA304SG & BA324SG**  
**Increased safety Ex eb and**  
**dust ignition protection by**  
**enclosure Ex tb**  
**loop-powered**  
**field mounting indicators**  
Issue 3

Certification  
information label

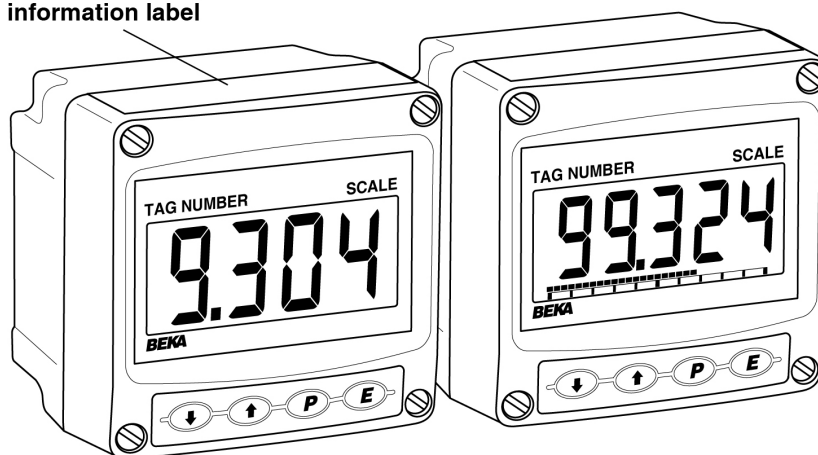

## CONTENTS

<b>1.</b>	<b>Description</b>	<b>8.</b>	<b>Maintenance</b>
<b>2.</b>	<b>Operation</b>	8.1	Fault finding during commissioning
2.1	Controls	8.2	Fault finding after commissioning
<b>3.</b>	<b>Certification</b>	8.3	Servicing
3.1	IECEEx, ATEX & UKEX Ex eb certification	8.4	Routine maintenance
3.2	Zones, gas groups & T rating	8.5	Guarantee
3.3	Specific conditions of use	8.6	Customer comments
3.4	Certification label information	<b>9.</b>	<b>Accessories</b>
<b>4.</b>	<b>System Design for Gas Hazardous Areas</b>	9.1	Units of measurement and instrument identification.
4.1	Transmitter loops	9.2	Display backlight
4.2	Remote indication	9.3	Pipe mounting kit
4.3	Monitoring hazardous area equipment	9.4	Panel mounting kit
<b>5.</b>	<b>Installation</b>		
5.1	Location		
5.2	Earthing		
5.3	Cable gland and conduit fittings		
5.4	Cables and wiring		
5.5	Installation procedure		
5.6	EMC		
5.7	Units of measurement and tag marking on scale card.		
<b>6.</b>	<b>Configuration and Calibration</b>		
6.1	Summary of configuration functions		
6.2	Indicator function: $F_{unL}$		
6.3	Resolution: $rESn$		
6.4	Position of the decimal point: $dP$		
6.5	Calibration using an external current source: $LR_L$		
6.6	Calibration using internal reference: $SE_L$		
6.7	Bargraph format and calibration: $BR_r$		
6.8	Function of the  push-button: $L--P$		
6.9	Tare function: $LR_rE$		
6.10	Security code: $LodE$		
6.11	Reset to factory defaults: $rSE_L$		
6.12	Under and over-range		
<b>7.</b>	<b>Lineariser</b>		
7.1	Lineariser calibration using an external current source.		
7.1.1	Example, Adding break-points to a new indicator.		
7.2	Lineariser calibration using internal reference.		
7.2.1	Example, Adding break-points to a new indicator.		
7.3	Under and over-range		
7.4	Lineariser default configuration		

### Appendix 1 Ex tb dust certification

The BA304SG and BA324SG are CE marked to show compliance with the European Explosive Atmospheres Directive 2014/34/EU and the European EMC Directive 2014/30/EU. They are also UKCA marked to show compliance with UK statutory requirements Equipment and Protective Systems Intended for Use in Potentially Explosive Atmospheres Regulations UKSI 2016:1107 (as amended) and with the Electromagnetic Compatibility Regulations UKSI 2016:1091 (as amended).

## 1. DESCRIPTION

The BA304SG and BA324SG are field mounting, increased safety Ex eb loop powered 4/20mA digital indicators. They are lower cost alternatives to flameproof Ex d indicators featuring large, easy to read displays.

Both models have IECEx, ATEX & UKEX certification and may be installed exactly as an Ex d flameproof indicator in Zones 1 or 2. The indicators may be safely connected in series with a 4/20mA hazardous area loop employing any type of certified explosion protection including, flameproof Ex d, pressurised Ex p, encapsulated Ex m or increased safety Ex e. The BA304SG and BA324SG indicators should not be used in intrinsically safe Ex i loops.

The BA304SG and BA324SG may also be used as an alternative to a certified Ex nA indicator in Zone 2.

Both indicators also have dust ignition protection by enclosure Ex tb that allows them to be installed in Zones 21 and 22. The indicator's dust certification is described in Appendix 1.

The two models are mechanically and electrically identical, but have different size displays. A factory fitted, loop powered display backlight is available as an option.

Model	Display
BA304SG	4 digits 34mm high.
BA324SG	5 digits 29mm high and 31 segment bargraph.

This instruction manual supplements the instruction sheet supplied with each instrument.

The main application of both models is to display a measured variable or control signal in a gas or dust hazardous process area. The zero and span of the display are independently adjustable, so that the indicator can be calibrated to display in engineering units any variable represented by the 4/20mA current, such as temperature, flow, pressure or level.

## 2. OPERATION

Fig 1 shows a simplified block diagram of both models. The indicators are loop powered by the 4/20mA input current and incorporate encapsulated Ex m and intrinsically safe Ex i assemblies, but the indicators do not require protection by a Zener barrier or a galvanic isolator.

Each time a 4/20mA current is applied to the indicator, initialisation is performed during which all segments of the display are activated, after five seconds the instrument displays the input current using the calibration information stored in the instrument's permanent memory. If the loop current is too low to power the instrument the indicator will display the error message  $LPL\Delta$ .

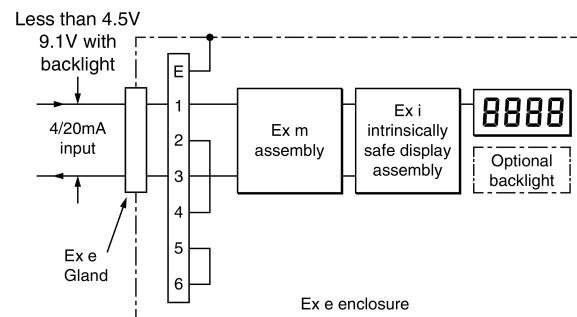










Fig 1 Indicator block diagram

## 2.1 Controls

Both models are controlled and calibrated via four front panel push buttons which may be operated while the indicator is energised in a hazardous area. In the display mode i.e. when the indicator is displaying a process variable, these push buttons have the following functions:

-  While this button is pushed the indicator will display the input current in mA, or as a percentage of the instrument span depending upon how the indicator has been configured. When the button is released the normal display in engineering units will return.
-  While this button is pushed the indicator will display the numerical value and analogue bargraph<sup>1</sup> the indicator has been calibrated to display with a 4mA<sup>2</sup> input. When released the normal display in engineering units will return.
-  While this button is pushed the indicator will display the numerical value and analogue bargraph<sup>1</sup> the indicator has been calibrated to display with a 20mA<sup>2</sup> input. When released the normal display in engineering units will return.
-  No function in the display mode unless the tare function is being used.
-  +  Indicator displays firmware number followed by version.
-  +  Provides access to the configuration menu via optional security code.

- Notes:**
- <sup>1</sup> Only the BA324SG has a bargraph
  - <sup>2</sup> If the indicator has been calibrated using the CAL function, calibration points may not be 4 and 20mA.

## 3. CERTIFICATION

Both models have IECEx and ATEX Ex eb increased safety and Ex tb dust ignition protection by enclosure certification.

This section of the instruction manual describes IECEx and ATEX Ex eb certification for installation in gas hazardous areas. Ex tb certification for installation in dust hazardous areas is described in Appendix 1.

## 3.1 IECEx, ATEX & UKEX Ex eb certification

Increased safety Ex eb is a type of electrical equipment protection which provides increased security against the possibility of excessive temperatures and against the occurrence of arcs and sparks. The requirements are defined by international standard EN 60079-7.

To allow the BA304SG and BA324SG to be installed in Zone 1, both indicators incorporate an encapsulated Ex mb assembly. This encapsulated assembly has an intrinsically safe Ex ib output which powers the display and optional display backlight.

Certification Body Intertek Testing and Certification Ltd have issued both models with a common Certificate of Compliance

IECEx ITS 19.0018X  
Ex eb ib mb IIC T5 Gb  
-40°C ≤ Ta ≤ +60°C

Intertek have also issued an ATEX EU - Type Examination Certificate:

ITS19ATEX304891X  
II 2G Ex eb ib mb IIC T5 Gb  
- 40°C ≤ Ta ≤ +60°C.

**Note:** Types of protection on both certificates are listed in alphabetical order.

The ATEX certificate confirms compliance with harmonised European standards which has been used to support a manufacturer's Declaration of Conformity confirming compliance with the European ATEX Directive for Group II, Category 2GD equipment.

The indicators carry the community mark and, subject to local codes of practice, may be installed in any of the European Economic Area (EEA) member countries. ATEX certificates are also acceptable for installations in Switzerland and some other countries - see Blue Book.

This section of the instruction manual describes installations in explosive gas atmospheres conforming with IEC / EN 60079-14 *Electrical installations design, selection and erection*. When designing systems for installation outside the UK the local Code of Practice should be consulted.

For more information about the certification techniques employed in these indicators, please see BEKA Application Guide AG320 which may be viewed and downloaded from the BEKA website [www.beka.co.uk](http://www.beka.co.uk)

### 3.2 Zones, gas groups and T rating

Both models have been certified Ex eb ib mb IIC T5 Gb  $-40^{\circ}\text{C} \leq T_a \leq +60^{\circ}$ . Types of explosion protection are listed in alphanumeric order. When connected in series with a 4/20mA loop the indicators may be installed in:

- |        |   |
|--------|---|
| Zone 1 | explosive gas air mixture likely to occur in normal operation.                                  |
| Zone 2 | explosive gas air mixture not likely to occur, and if it does will only exist for a short time. |

Be used with gases in groups:

- |         |          |
|---------|----------|
| Group A | propane  |
| Group B | ethylene |
| Group C | hydrogen |

In gases that may be used with equipment having a temperature classification of:

- |    |       |
|----|-------|
| T1 | 450°C |
| T2 | 300°C |
| T3 | 200°C |
| T4 | 135°C |
| T5 | 100°C |

Rated voltage  $U_N$   
 $U_N$  30V dc.

At ambient temperatures between  $-40$  and  $+60^{\circ}\text{C}$ .

This allows both indicators to be used with most common industrial gases except carbon disulphide and ethyl nitrite which have an ignition temperature of  $95^{\circ}\text{C}$ .

### 3.3 Specific conditions of use

The IECEx and ATEX certificate numbers have an 'X' suffix indicating that specific conditions apply.


Both certificates state that the indicators should be powered from a SELV (*separated or safety extra low voltage*) or PELV (*protected extra-low voltage supply*), or from an adequately approved supply providing double or reinforced insulation as specified in IEC 60079-14.

This requirement also applies to flameproof equipment and does not usually cause any difficulties because the power supply is required to be safe for personnel contact. In European terms, compliance with the Low Voltage Directive ensures that this requirement is met.

Like most flameproof indicators, the BA304SG and BA324SG Ex eb ib mb indicators have no maximum input current rating, only a maximum voltage rating  $U_N$  of 30V. The BA304SG and BA324SG indicators may therefore be used in exactly the same way as a certified flameproof indicator, providing the loop supply voltage is isolated and equal to or less than 30V.

### 3.4 Certification label information

The certification information label is fitted on the top surface of the instrument assembly. It shows the IECEx, ATEX and UKEX certification information and BEKA associates name and location. Non European certification information may also be shown. The instrument serial number and date of manufacture are recorded on a separate label inside the instrument enclosure.

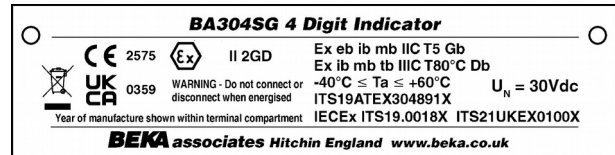

BA304SG certification label

#### 4. SYSTEM DESIGN FOR GAS HAZARDOUS AREAS.

These indicators are versatile and simple to apply, allowing them to be safely connected to hazardous area equipment employing any type of certified explosion protection such as, flameproof Ex d, pressurised Ex p, increased safety Ex e or Ex nA. They should not be used with energy limited protected equipment such as intrinsic safety Ex i or Ex nL.

##### 4.1 Transmitter loops

The BA304SG and BA324SG may be connected in series with almost any hazardous area Zone 1 or Zone 2 4/20mA loop. They can be configured and calibrated on-site to display a measured variable or control signal in engineering units. The indicators are transparent to HART® signals.

There are three simple design requirements:

1. The loop must be able to tolerate the additional 5.3V required to operate the indicator. When fitted with an optional backlight this increases to 9.1V
2. The 4/20mA loop supply voltage must not exceed 30V.
3. The indicator should be fitted with Ex e certified cable glands and / or stopping plug.
4. Wiring should comply with the requirements of IEC 60079-14 *Electrical installations design, selection and erection*.

Figs 2 illustrates a typical application in which an indicator is connected in series with a 2-wire flameproof Ex d transmitter. Alternatively an increased safety Ex e, pressurised Ex p, or in Zone 2, a Type n Ex nA transmitter could be used.

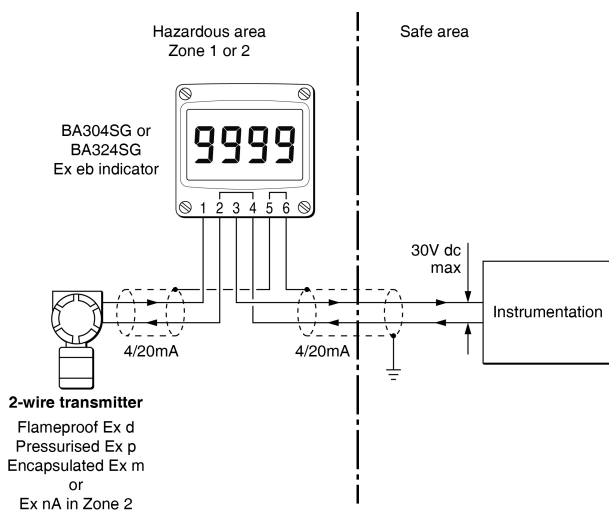


Fig 2 Typical application showing indicator displaying transmitter output.

##### 4.2 Remote indication

Both models may be driven from a safe area instrument with a 4/20mA output to provide a remote display within a Zone 1 or 2 hazardous area as shown in Fig 3.

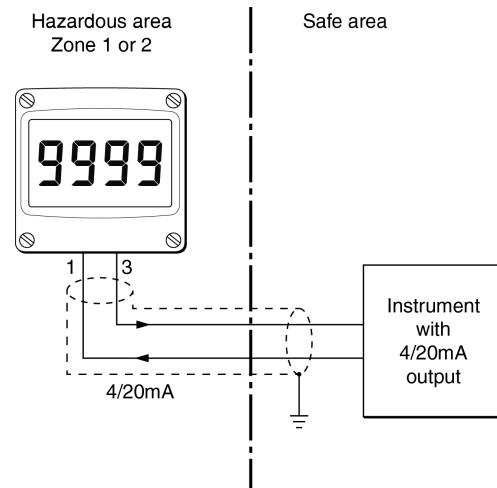


Fig 3 Remote indication in Zone 1 or 2

##### 4.3 Monitoring hazardous area equipment

The BA304SG and the BA324SG also provide a convenient way of monitoring a 4/20mA process variable in hazardous area equipment protected by a flameproof Ex d enclosure.

Fig 4 shows how a 4/20mA output can be brought via an Ex d gland from a flameproof enclosure and displayed by a local BA304SG or BA324SG indicator without the need for a Zener barrier or galvanic isolator within the flameproof enclosure.

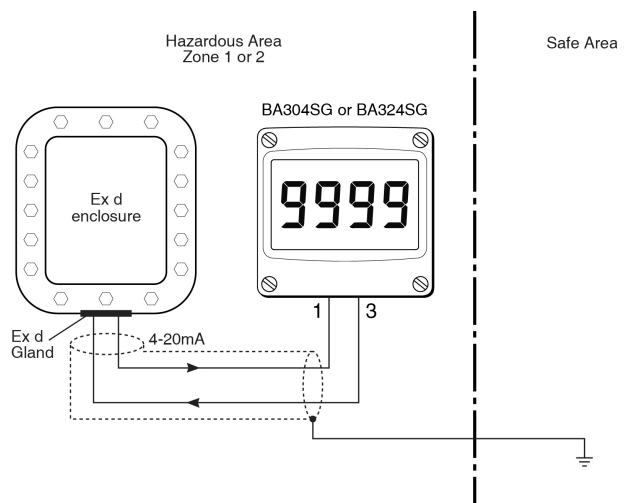


Fig 4 Monitoring equipment protected by a flameproof enclosure in Zone 1 or 2.

A similar technique may be used to monitor equipment protected by a pressurised Ex p enclosure.

## 5. INSTALLATION

### 5.1 Location

BA304SG and BA324SG indicators have a robust GRP enclosure that provides IP66 ingress protection after a 7J impact. The thick armoured glass window will withstand a 4J impact. Both indicators are suitable for exterior mounting in most industrial on-shore and off-shore installations.

The indicators should be positioned where the display is not in continuous direct sunlight.

The field wiring terminals are located within the indicator enclosure back-box as shown in Fig 8. Indicator terminals 2 and 4 are internally joined and may be used for linking the return 4/20mA wire. Similarly, terminals 5 and 6 are internally joined and may be used for linking cable screens as shown in Figs 2 and 8.

The indicators are surface mounting, but may be pipe or panel mounted using one of the accessory kits described in sections 9.3 and 9.4.

### 5.2 Earthing

To prevent the build up of an electrostatic charge the indicator enclosure is slightly electrically conductive. If the indicator enclosure is not mounted on a metal structure that provides a discharge path, it should be earthed using the instrument's internal earth terminal.

### 5.3 Cable glands and conduit fittings

Both back-box cable entries have M20 x 1.5 threads. The right hand entry is fitted with an Ex e and Ex t certified stopping plug and the left hand entry with a temporary plug to prevent the ingress of dust and dirt during transportation.

Ex e plastic or metallic cable glands or conduit entries may be used. If two armoured cables are used, the armour on each cable should be earthed.

### 5.4 Cables and wiring

All Zone 1 and 2 wiring for any type of explosion protection, apart from intrinsic safety, should be mechanically robust, having a toughened outer sheath or armour. Wiring should have adequate voltage and current rating and should comply with the requirements of IEC60079-14 Section 9 *Cables and Wiring Systems*.

Cables should be suitable for the anticipated operating temperature, protected from voltage overloads and have a clearly defined means of isolation.

No additional cable or wiring requirements are necessary for BA304SG and BA324SG indicators.

### 5.5 Installation Procedure

Fig 6 illustrates the instrument installation procedure for both models.

- A. Remove the indicator assembly by unscrewing the four captive 'A' screws. Lift the indicator assembly off the back-box and disconnect the two wires from the back-box using a small screwdriver to unlatch the connector locking mechanism as shown in Fig 5.
- B. Mount the enclosure back-box on a flat surface and secure with screws or bolts through the four 'B' holes. Alternatively use a pipe or panel mounting kit described in sections 9.3 and 9.4.
- C. Remove the temporary hole plug from the left hand cable entry and install an Ex e certified cable gland or conduit fitting. If two cable entries are required, the Ex e stopping plug fitted in the right hand cable entry should be removed and replaced with an Ex e certified cable gland or conduit fitting.
- D. Connect the field wiring to the terminals in the back-box as shown in Fig 8. If the indicator enclosure is not mounted on a metal structure that provides a discharge path, it should be earthed via the earth terminal.
- E. Check that the indicator assembly sealing gasket is free from foreign bodies and plug the instrument assembly cable into the socket on the back-box. Finally replace the indicator assembly onto the back-box and evenly tighten the four 'A' screws.

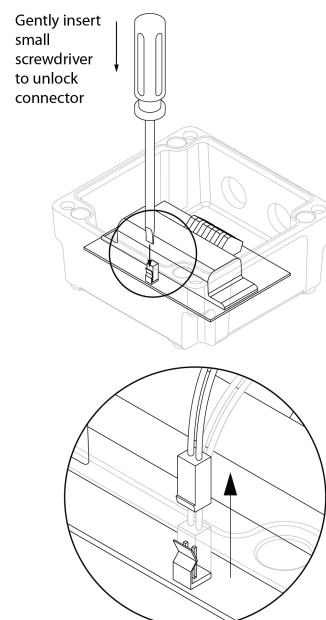


Fig 5 Unlatching the indicator assembly connector using a small screwdriver.

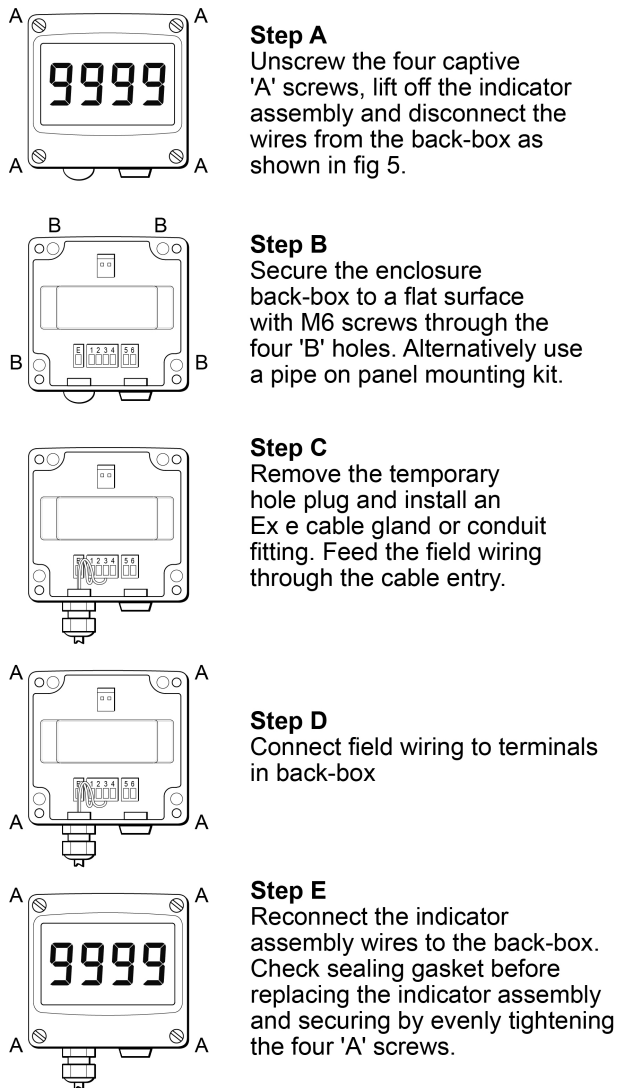


Fig 6 Installation procedure


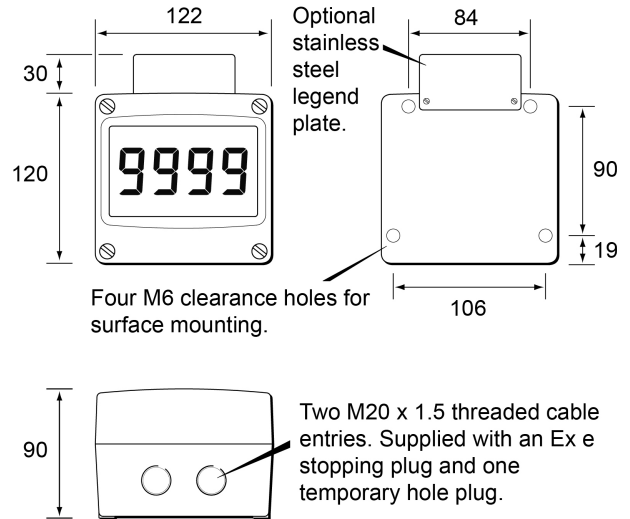


Fig 7 Dimensions of BA304SG and BA324SG.

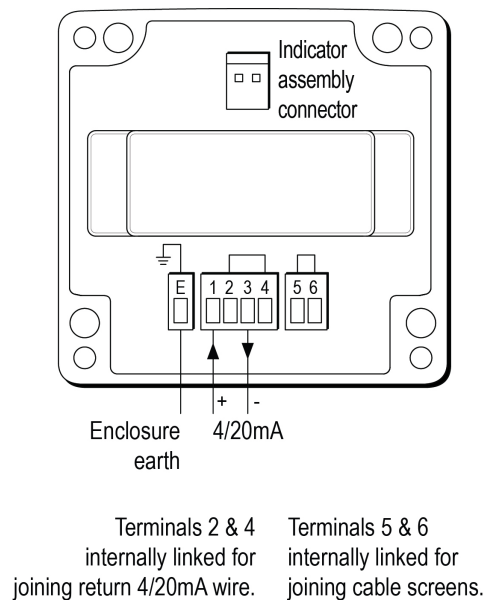

Each terminal can accommodate one 0.2 - 2.5mm<sup>2</sup> solid conductor.

OR

One 0.2 - 1.5mm<sup>2</sup> stranded conductor.

Fig 8 Terminal connections



## 5.6 EMC

Both models comply with the requirements of the European EMC Directive and the UK Statutory Requirements. For specified immunity all wiring should be in screened twisted pairs, with the screens earthed at one point in the safe area.

## 5.7 Units of measurement and tag marking on scale card.

The indicator's units of measurement and tag information are shown on a scale card which slides into the indicator.

New indicators can be supplied with a printed scale card showing the requested units of measurement and tag information for no additional cost. If this information is not supplied when the indicator is ordered, a blank scale card will be fitted which can easily be marked on-site with a dry transfer or a permanent marker. Custom printed scale cards are available from BEKA associates as an accessory.

To remove the scale card from an indicator carefully pull the transparent tab at the rear of the indicator assembly away from the indicator as shown in Fig 9a.

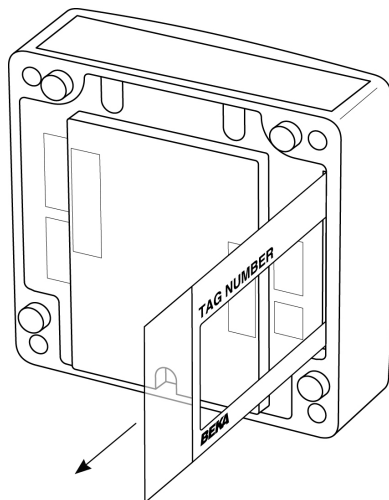


Fig 9a Removing scale card

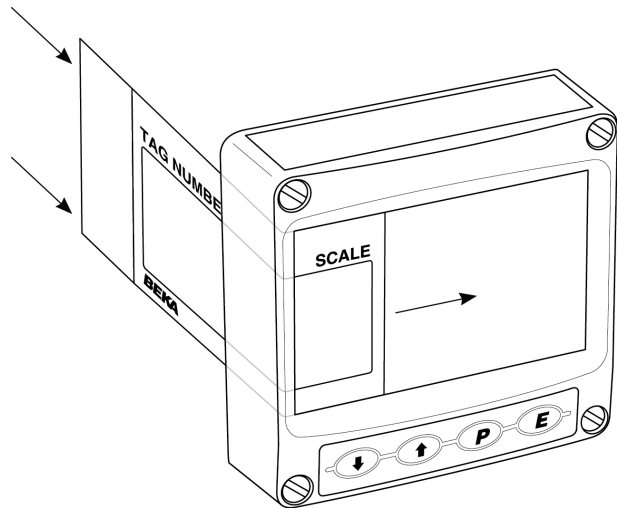


Fig 9b Inserting scale card into the instrument assembly.

To replace the scale card carefully insert it into the slot on the right hand side of the input terminals as shown in Fig 9b. Force should be applied evenly to both sides of the scale card to prevent it twisting. The card should be inserted until about 2mm of the transparent tab remains protruding.

## 6. CONFIGURATION AND CALIBRATION

Both models are configured and calibrated via the four front panel push buttons. The configuration functions are contained in an easy to use intuitive menu that is shown diagrammatically in Fig 10.

Each menu function is summarised in section 6.1 and includes a reference to more detailed information.

Throughout this manual push buttons are shown as **P**, **E**, **▼** or **▲**, and display legends are shown in a seven segment font exactly as displayed by the indicator e.g. **RL** and **RR**.

Access to the configuration menu is obtained by operating the **P** and **E** push buttons simultaneously. If the indicator security code is set to the default 0000 the first parameter **Func** will be displayed. If a security code other than the default code 0000 has already been entered, the indicator will display **Code**. Pressing the **P** button will clear this prompt allowing each digit of the code to be entered using the **▼** or **▲** push button and the **P** button to move control to the next digit. When the correct four digit code has been entered pressing **E** will cause the first parameter **Func** to be displayed. If the code is incorrect, or a button is not pressed within twenty seconds, the indicator will automatically return to the display mode.

Once within the configuration menu the required parameter can be reached by scrolling through the menu using the **▼** or **▲** push button as shown in Fig 10. When returning to the display mode following recalibration or a change to any function, the indicator will display **dRR** followed by **SRUE** while the new information is stored in permanent memory.

All new indicators are supplied calibrated as requested at the time of ordering. If calibration is not requested, indicators will be supplied with the following default configuration:

### Default Configuration

	BA304SG	BA324SG
Access code <b>Code</b>	0000	0000
Function <b>Func</b>	Linear	Linear
Display at 4mA <b>Zero</b>	0.0	0.00
Display at 20mA <b>Span</b>	100.0	100.00
Resolution <b>Resn</b>	1 digit	1 digit
Bargraph start <b>BarLo</b>	----	0.00
Bargraph finish <b>BarHi</b>	----	100.00
<b>P</b> button in display mode <b>EEP</b> %	%	%
Tare <b>TRR</b>	Off	Off

## 6.1 Summary of configuration functions

This section summarises each of the main configuration functions and includes a cross reference to a more detailed description. Fig 10 illustrates the location of each function within the configuration menu. The lineariser is described separately in section 7 of this manual.

### Display Summary of function

#### **Func** Indicator function

Defines the relationship between the 4/20mA input current and the indicator display. May be set to:

- Std** Standard linear relationship
- root** Square root extraction
- Lin** 16 segment adjustable lineariser – see section 7.

See section 6.2

#### **Resn** Display resolution

Defines the resolution of the least significant display digit. May be set to 1, 2, 5 or 10 digits.

See section 6.3

#### **dP** Decimal point

Positions a dummy decimal point between any of the digits or turns it off.

See section 6.4

#### **RL** Calibration of the digital display using an external current source.

Enables the zero and span of the indicator to be adjusted using an external current source such as a calibrator. When used with an accurate traceable current source this is the preferred method of calibration.

See section 6.5

#### **SEt** Calibration of display using internal references.

Enables the zero and span of the indicator to be adjusted without the need for an accurate input current or disconnection from the 4/20mA loop. See section 6.6

#### **Bar** Bargraph format and calibration

*Only the BA324SG has a bargraph.*

The bargraph may be conditioned to start from left, right or centre of the display, or it may be disabled. The bargraph may be calibrated to start and finish at any value within the indicator's calibrated digital display.

See section 6.7



◀ or ▶

Display	Summary of function
---------	---------------------

**[--P] Function of [P] push button**

The indicator may be configured to display the input current in milliamps, or the input current as a percentage of the 4/20mA input when the [P] push button is operated in the display mode. See section 6.8

**tRrE Tare function**

When enabled, the tare function sets the indicator display to zero when the [E] push button is operated in the display mode.

See section 6.9

**[adE] Security code**

Defines a four digit alpha numeric code that must be entered to gain access to the configuration menu. Default code 0000 disables this security function and allows unrestricted access to all conditioning functions.

See section 6.10

**r5Et Reset**

Contains two sub-functions, [onF which returns the indicator to the default conditions shown in section 6.0, and LtRb which returns the lineariser to the default conditions shown in section 7.4. To prevent accidental use both resets must be confirmed by entering 5urE before they will be executed.

See section 6.11

**6.2 Indicator function: FunC**

This configuration function defines the relationship between the indicator's 4/20mA input current and the indicator's display. Three alternatives are available:

Std	Standard linear relationship
root	Square root extraction
Lin	16 segment adjustable lineariser

To reveal the indicator's existing function select FunC from the configuration menu and press [P]. If the function is set as required, press [E] to return to the menu, or press the [▼] or [▲] button to change the setting, followed by the [E] button to return to the configuration menu.

**Std Linear**

Provides a linear relationship between the 4/20mA indicator input current and the indicator display.

**root Square root extraction**

Primarily intended to linearise the square law 4/20mA output from differential flowmeters.

For reference, the following table shows the output current from a non-linearised differential flowmeter.

% of full flow	Current output mA
2.5	4.01
10.0	4.16
25.0	5.00
50.0	8.00
75.0	13.00
100.0	20.00

When the root function is selected the indicator will display flow in linear units.

**Lin 16 segment adjustable lineariser**

Enables non-linear variables to be displayed by the indicator in linear engineering units. Use of the lineariser is described in section 7 of this instruction manual.

**6.3 Resolution: rE5n**

This function defines the resolution of the least significant display digit. Decreasing the display resolution can improve the readability of a noisy signal. Select rE5n from the menu and press [P] which will reveal the current display resolution. To change the resolution press the [▼] or [▲] button to select 1, 2, 5 or 10 digits, followed by the [E] button to enter the selection and return to the configuration menu.

#### 6.4 Position of the decimal point: $dP$

A dummy decimal point can be positioned between any of the digits or it may be absent. To position the decimal point select  $dP$  from the menu and press  $[P]$ . The decimal point can be moved by pressing the  $\blacktriangledown$  or  $\blacktriangle$  push button. If a decimal point is not required it should be positioned beyond the most or least significant digit. When positioned as required press the  $[E]$  button to enter the selection and return to the configuration menu.

#### 6.5 Calibration using an external current source: $ERL$

This function enables the zero and span of the indicator to be adjusted using an external calibrated current source. When used with an accurate traceable current source this is the preferred method of calibration.

Zero is the indicator display with 4mA input  
Span is the indicator display with 20mA input

To calibrate the indicator select  $ERL$  from the configuration menu and press  $[P]$ . The indicator will display  $ZER0$  which is a request for a 4mA input current. Adjust the external current calibrator to 4.000mA and again press  $[P]$  which will reveal the existing zero display. The flashing digit of the indicator display can be changed by pressing the  $\blacktriangledown$  or  $\blacktriangle$  buttons, when set as required pressing  $[P]$  will transfer control to the next digit. When all the digits have been adjusted, press  $[E]$  to enter the new zero and return to the  $ZER0$  prompt.

Pressing the  $\blacktriangle$  button will cause the indicator to display  $SPRn$  which is a request for a 20mA input current. Adjust the external current calibrator to 20.000mA and again press  $[P]$  which will reveal the existing span display. The flashing digit of the indicator display can be changed by pressing the  $\blacktriangledown$  or  $\blacktriangle$  buttons, when set as required pressing  $[P]$  will transfer control to the next digit. When all the digits have been adjusted press  $[E]$  to enter the new span and return to the  $SPRn$  prompt. Finally press  $[E]$  again to return to the configuration menu.

#### Notes:

- The indicator input current must be adjusted to the required value before the zero and span functions are entered by pressing the  $[P]$  button.
- Indicators may be calibrated at currents other than 4 and 20mA, within the range 3.8 to 21.0mA providing the difference between the two currents is greater than 4mA. If these conditions are not complied with, the indicator displays  $ERR$  and aborts the calibration.
- If the zero current is greater than the span current the instrument will be reverse acting i.e. an increasing input current will cause the display to decrease.

#### 6.6 Calibration using internal reference: $SEI$

Using the  $SEI$  function the indicator can be calibrated without the need to know the value of the 4/20mA input current, or to disconnect the indicator from the 4/20mA loop.

When using the  $SEI$  function the indicator's internal reference is used to simulate a 4mA and 20mA input current.

Zero is the display with a simulated 4mA input  
Span is the display with a simulated 20mA input

To calibrate the indicator display select  $SEI$  from the configuration menu and press  $[P]$ . The indicator will display  $ZER0$ , pressing  $[P]$  again will reveal the existing display at 4mA. The flashing digit can be adjusted by pressing the  $\blacktriangledown$  or  $\blacktriangle$  buttons, when the flashing digit is correct pressing  $[P]$  will transfer control to the next digit. When all the digits have been adjusted, press  $[E]$  to return to the  $ZER0$  prompt.

To adjust the display at 20mA, press the  $\blacktriangle$  button which will cause the indicator to display  $SPRn$ , pressing  $[P]$  will then reveal the indicator's existing display at 20mA. The flashing digit can be adjusted by pressing the  $\blacktriangledown$  or  $\blacktriangle$  buttons, when the flashing digit is correct pressing  $[P]$  will transfer control to the next digit. When all the digits have been adjusted press  $[E]$  to return to the  $SPRn$  prompt followed by  $[E]$  to return to the  $SEI$  prompt in the configuration menu.

#### 6.7 Bargraph format and calibration: $BAR$

*Only the BA324SG has a bargraph.*

In addition to a five digit numerical display the BA324SG has a 31 segment analogue bargraph which may be configured to start and finish anywhere within the indicator's numerical display range.

To configure the bargraph select  $BAR$  from the configuration menu and press  $[P]$ . The indicator will display  $TYPE$ , pressing  $[P]$  again will reveal the existing bargraph justification which can be changed to one of the following four or five options using the  $\blacktriangledown$  or  $\blacktriangle$  button:

#### Bargraph justification starts from

$LEFT$	Left end of display
$CENTR$	Centre of display
$RIGHT$	Right end of display
$OFF$	Bargraph disabled

When set as required press  $[E]$  to return to the  $TYPE$  sub-function prompt.

The indicator's digital display at which the bargraph starts is defined by the **bArLo** sub-function which is selected by pressing the **▲** button followed by the **P** button which will reveal the existing indicator display at which the bargraph starts. The flashing digit can be adjusted by pressing the **▼** or **▲** buttons, when set as required pressing **P** will transfer control to the next digit. When all the digits have been adjusted, press **E** to return to the **bArLo** prompt from which **bArHi** which defines the finishing point of the bargraph can be selected by pressing the **▲** button. **bArHi** is adjusted in the same way as **bArLo**. When set as required, pressing **E** twice will return the display to the **bAr** prompt in the configuration menu.

**Note:** **bArLo** must be set lower than **bArHi**, incorrect setting is indicated by the bargraph scale flashing with a single bargraph segment activated.

### 6.8 Function of the **P** push button: **[-P**

When the indicator is in the display mode, operating the **P** push button will display the input current in milliamps, or the displayed value as a percentage of the difference between the displayed values at 4mA and 20mA inputs.

To check or change the function of the **P** push button select **[-P** from the configuration menu and press **P** to reveal the existing setting. Pressing the **▼** or **▲** button will toggle the setting between **4-20** the current display in milliamps and **P%** the percentage display. When set as required press **E** to return to the **[-P** prompt in the configuration menu.

### 6.9 Tare function: **tArE**

The tare function is primarily intended for use with a weighing system. When the indicator is in the display mode and the tare function is activated, pressing the **E** button for more than three seconds will zero the indicator's digital display and activate the tare annunciator. The BA324SG bargraph remains linked to the digital display when the tare function is activated. Subsequent operation of the **E** push button for less than 3 seconds will return the indicator to the gross display and deactivate the tare annunciator.

To check or change the tare function select **tArE** from the configuration menu and press **P** to reveal the existing setting. Pressing the **▼** or **▲** button will toggle the setting between **on** and **off**. When set as required press **E** to return to the **tArE** prompt in the configuration menu.

### 6.10 Security code: **LoDE**

Access to the instrument configuration menu may be protected by a four digit security code that must be entered to gain access. New instruments are configured with the default security code **0000** which allows unrestricted access to all configuration functions.

To enter a new security code select **LoDE** from the configuration menu and press **P** which will cause the indicator to display the existing security code with one digit flashing. The flashing digit can be adjusted using the **▼** or **▲** push buttons, when set as required operating the **P** button will transfer control to the next digit. When all the digits have been adjusted press **E** to return to the **LoDE** prompt in the configuration menu. The revised security code will be activated when the indicator is returned to the display mode. Please contact BEKA associates sales department if the security code is lost.

### 6.11 Reset to factory defaults: **rSEt**

This function enables the indicator and the lineariser to be quickly returned to the factory default configurations shown in section 6.0.

To reset the indicator or lineariser select **rSEt** from the configuration menu and press **P**, the indicator will display one of the reset options **LoNF** or **LEAb**.

<b>LoNF</b>	Resets the indicator to defaults
<b>LEAb</b>	Resets the lineariser to defaults

Using the **▼** or **▲** push button select the required sub-function and press **P**. To prevent accidental resetting the request must be confirmed by entering **5urE**. Using the **▲** button set the first flashing digit to 5 and press **P** to transfer control to the second digit which should be set to **u**. When **5urE** has been entered pressing the **E** button will reset the selected configuration menus and return the display to the **rSEt** function in the configuration menu.

### 6.12 Under and over-range

If the numerical display range of the indicator is exceeded, all the decimal points will flash as shown below:

	<b>BA304SG</b>	<b>BA324SG</b>
Underrange	-9.9.9.9	-9.9.9.9
Overrange	9.9.9.9	9.9.9.9

Although not guaranteed, most indicators will continue to function normally with an input current between 1.8mA and 4mA, at lower currents the instrument will display **LPLo** before it stops functioning.

Under or over-range of the BA324SG bargraph is indicated by a flashing arrow at the appropriate end of the bargraph.

## 7. LINEARISER

A sixteen segment, seventeen break-point (0 to 16) lineariser may be selected in the *F<sub>un</sub>C* section of the configuration menu. The position of each break-point is fully adjustable so that the slope of the straight line between break-points can be set to compensate for input non-linearity, thus allowing the indicator to display non-linear process variables in linear engineering units. Each break-point must occur at a current greater than the preceding break-point and less than the following break-point, in the range 3.8 to 21.0mA. If this requirement is not observed when configuring the lineariser the indicator will display *FR, L* and the configuration adjustment which produced the error message will be ignored. Fig 11 shows a typical linearised indicator characteristic.

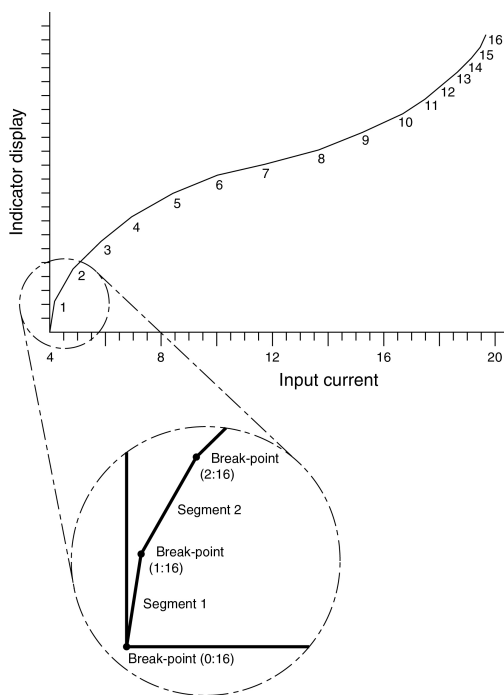


Fig 11 shows a typical linearising characteristic

Selecting *L<sub>in</sub>* in the *F<sub>un</sub>C* section of the configuration menu activates the lineariser, this does not change the configuration menu shown in Fig 10, but the *CR<sub>L</sub>* and *SE<sub>L</sub>* functions are extended as shown in Fig 12. As with a linear indicator, calibration of the lineariser may be performed with an external current source using the *CR<sub>L</sub>* function, or with the internal reference using the *SE<sub>L</sub>* function.


The lineariser calibration is retained irrespective of how the indicator function *F<sub>un</sub>C* is subsequently changed. It is therefore possible to select and deselect the lineariser without having to reconfigure it each time.

The lineariser calibration may be reset to the factory default settings without changing the indicator configure using the *LE<sub>R</sub>B* function described in section 6.11.

### 7.1 Lineariser calibration using an external current source.

This method allows direct calibration of the lineariser with an external current source and is the preferred method when traceability is required. If the exact system non-linearity is unknown, this method also allows direct calibration from the variable to be displayed. e.g. the output from a level sensor in an irregular tank may be displayed in linear volumetric units by filling the tank with known incremental volumes and calibrating the indicator to display the sum of the increments at each break-point.

The number of break-point required should first be entered using the *R<sub>dd</sub>* and *dEL* functions. In both these sub-functions the indicator initially displays the current break-point and the total number of break-points being used as shown below.

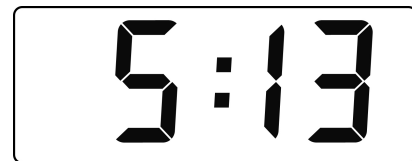

current      total number  
break-point   of break-points








Display	Summary of function
---------	---------------------


<b>R<sub>dd</sub></b>	<b>Add a break-point</b>
-----------------------	--------------------------

Adds a new break-point before the displayed break-point. The calibration of existing break-points is not changed, but the identification number of all subsequent break-points is increased by one.
---

<b>dEL</b>	<b>Remove a break-point</b>
------------	-----------------------------

Removes the displayed break-point and joins the preceding break-point to the following break-point with a straight line. The identification number of all subsequent break-points is decreased by one.
--

To add a break-point use the  or  button to select *CR<sub>L</sub>* from the configuration menu and press  which will result in the *R<sub>dd</sub>* sub-function prompt being displayed. To enter the sub-function press  which will reveal the current break-point and the total number of break-points which have already been entered. When adding a break-point the insertion position can be selected using the  or  push button followed by  push button to insert the additional break-point. In previously uncalibrated linearisers each new break-point should be added in front of the highest existing break-point, if this sequence is not followed a *FR, L* message will occur in the *P<sub>t</sub>S* function. See example in section 7.1.1.

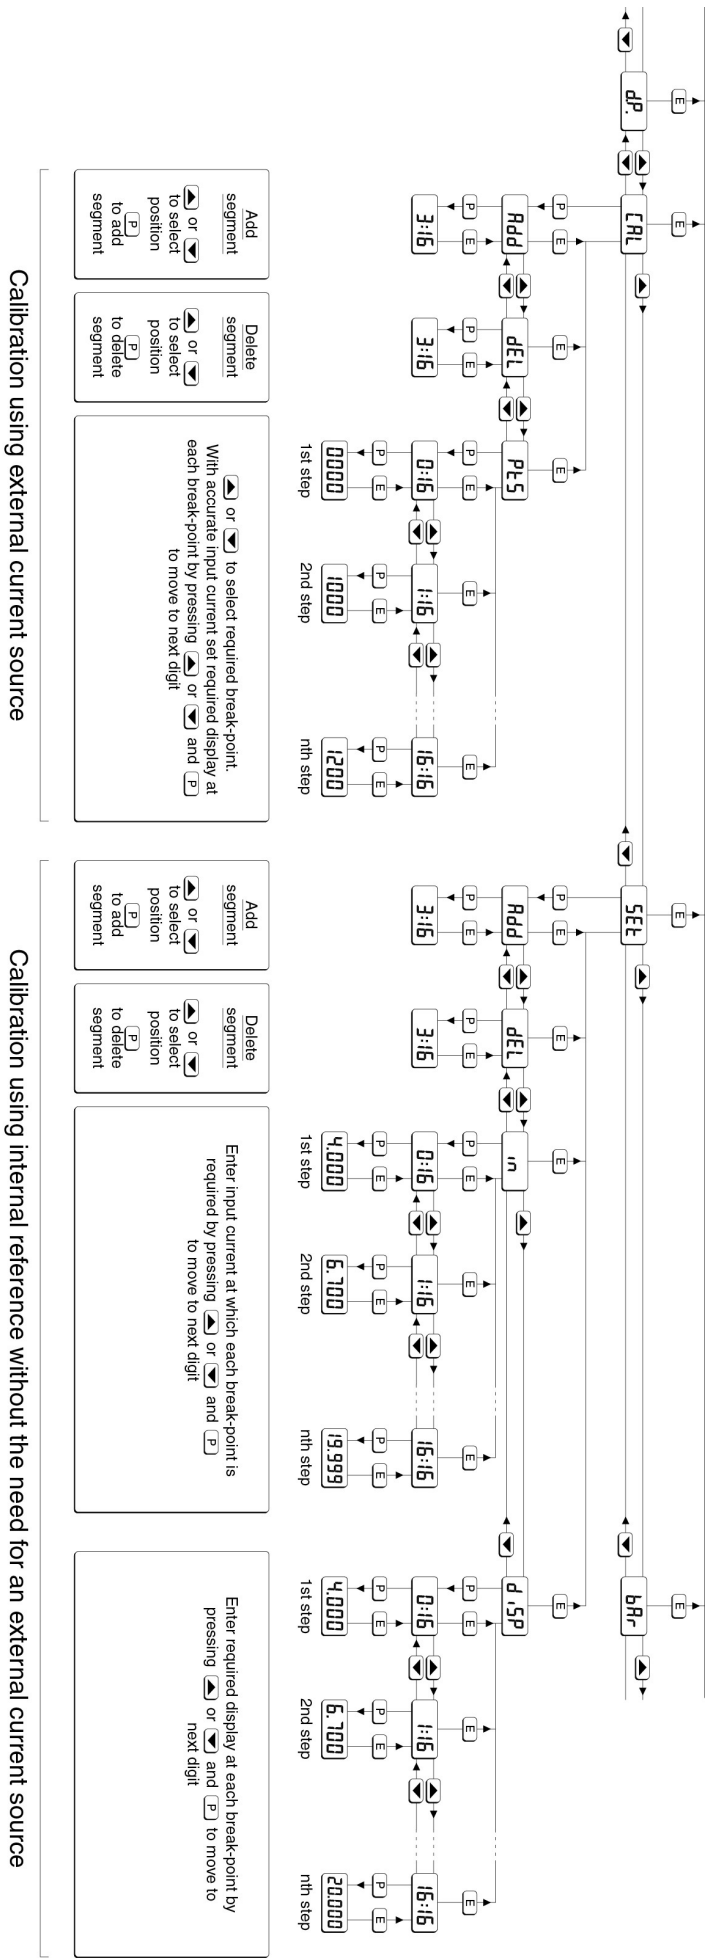

Each break-point must occur at an input current greater than the preceding break-point and less than the following break-point, in the range 3.8 to 21.0 mA

Fig 12 Extension of CAL and SET functions for lineariser configuration



The delete break-point sub-function  $dEL$  operates in exactly the same way as the  $Rdd$  sub-function described above. Once within the  $dEL$  sub-function each time the  $\square$  button is pressed a break-point is removed. When deleting a break-point from a calibrated indicator, the break-point to be deleted can be selected using the  $\blacktriangledown$  or  $\blacktriangle$  push button. The minimum number of break-points is 2, break-points  $0:1$  and  $1:1$ .

When the required number of linearising break-points has been entered, return to the linearisation sub-menu by pressing  $\square$ . The indicator will display the  $Rdd$  or  $dEL$  prompt depending upon the last function used. Using the  $PE5$  sub-function the input current at which each break-point occurs and the corresponding indicator display may now be defined.

Using the  $\blacktriangledown$  or  $\blacktriangle$  button select the  $PE5$  function in the sub-menu and press  $\square$  to enter the function which will display the first break-point  $0:n$ , where  $n$  is the total number of linearising break-points entered - see Fig 12. The selected linearising break-point can be changed using the  $\blacktriangledown$  or  $\blacktriangle$  buttons. When the required linearising break-point has been selected set the indicator input current to the exact value at which the break-point is required and press  $\square^*$ . Using the  $\blacktriangledown$  and  $\blacktriangle$  buttons and the  $\square$  button to move between digits, enter the required indicator display at this break-point. When set as required, press the  $\square$  push button to enter the required indicator display and return to the sub-menu from which the next break-point can be selected.

When all the break-points have been calibrated pressing  $\square$  twice will return the indicator to the 'CAL' function in the configuration menu.

**Note:** \* The indicator input current must be adjusted to the required value before the  $\square$  button is operated to enter the required indicator display.

#### Error message

**If during calibration the indicator displays a  $FR, L$  error message the current at which the selected break-point is being set is not above the preceding break-point or is not below the following break-point.**

#### 7.1.1 Example

##### Adding break-points to a new indicator

When adding break-points to a new indicator, or to a lineariser following resetting to the factory defaults using the  $r5Et$  function described in section 6.11, each additional break-point should be added before the highest existing breakpoint. The first additional break-point should be added before the default break-point  $1:1$  which will result in a display of  $1:2$ . If more new break-points are

required, using the  $\blacktriangle$  button select the new highest break-point  $2:2$  and add the second additional break-point by operating the  $\square$  push button which will result in a display of  $2:3$ . Repeat the sequence until the required number of break-points has been entered.

The input current at which each break-point occurs and the corresponding indicator display may now be entered as described above.


## 7.2 Lineariser calibration using the internal reference.

The  $5Et$  function enables the lineariser to be calibrated without the need for an accurate external current source. Throughout the calibration the indicator input current may be any value between 4 and 20mA.

The  $5Et$  functions contains four sub-functions.

Display	Summary of function
$Rdd$	Add a break-point Adds a new break-point before the displayed break-point. The calibration of existing break-points is not changed, but the identification number of all subsequent break-points is increased by one.
$dEL$	Remove a break-point Removes the displayed break-point and joins the preceding segment to the following segment with a straight line. The identification number of all subsequent break-points is decreased by one.
$0:n$	Defines the current at which break-point occurs. Enables the required current at each break-point to be defined without having to input an accurate input current to the indicator.
$d, 5P$	Defines indicator display at break-point. Enables the indicator display at each break-point to be defined.

The number of break-points required should first be entered using the  $Rdd$  and  $dEL$  sub-functions. In both these sub-functions the indicator initially displays the current break-point and the total number of break-points being used as shown below.

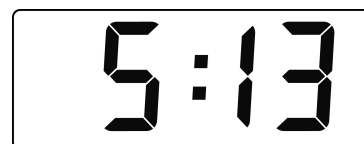

current      total number  
break-point   of break-points

To add a break-point using the  $\blacktriangledown$  or  $\blacktriangle$  button select 5EL from the configuration menu and press  $\text{P}$  which will result in the Add sub-function prompt being displayed. To enter the sub-function press  $\text{P}$  which will reveal the current break-point and the total number of break-points which have already been entered. When adding a break-point the insertion position can be selected using the  $\blacktriangledown$  or  $\blacktriangle$  push buttons followed by  $\text{P}$  push button to insert the additional break-point. In previously uncalibrated linearisers each new break-point should be added in front of the highest existing break-point, if this sequence is not followed a FR, L message will occur when the break-points are calibrated. See example in section 7.2.1.

The delete a break-point, sub-function dEL operates in exactly the same way as the Add sub-function described above. Once within the dEL function each time the  $\text{P}$  button is pressed a break-point is removed. When deleting a break-point from a calibrated indicator, the break-point to be deleted can be selected using the  $\blacktriangledown$  or  $\blacktriangle$  push button. The minimum number of break-points is 2, break-points 0:1 and 1:1.

When the required number of linearising break-points has been entered, return to the linearisation sub-menu by pressing  $\text{E}$ . The indicator will display the Add or dEL prompt depending upon the last sub-function used. The indicator input current and corresponding indicator display at each break-point, which is the segment finishing point as shown in Fig 11, can now be entered using the  $\text{I:n}$  and  $\text{d, 5P}$  sub-functions.

Using the  $\blacktriangledown$  or  $\blacktriangle$  button select  $\text{I:n}$  from the sub-menu and press  $\text{P}$  which will reveal the starting point for the first segment 0:n, where n is the total number of break-points entered. Press  $\text{P}$  and use the  $\blacktriangledown$  and  $\blacktriangle$  buttons and the  $\text{P}$  button to move between digits, to enter the input current in milliamps at which the first break-point is required, usually 4.000mA. When set as required, press  $\text{E}$  to return to the 0:n prompt from which the next break-point can be selected using the  $\blacktriangledown$  and  $\blacktriangle$  buttons. When the required break-point has been selected press  $\text{P}$  and enter the indicator input current at which this break-point is required using the  $\blacktriangledown$  and  $\blacktriangle$  buttons and the  $\text{P}$  button to move between digits. Repeat this procedure until the indicator input current at all the break-points has been defined and then return to the  $\text{I:n}$  sub-function by pressing the  $\text{E}$  button.

The corresponding indicator display at each of the break-points can now be defined using the  $\text{d, 5P}$  sub-function. Using the  $\blacktriangledown$  and  $\blacktriangle$  buttons select the  $\text{d, 5P}$  sub-function and press  $\text{P}$  which will reveal the starting point for the first break-point 0:n, where n is the total number of break-points entered.

Press  $\text{P}$  and use the  $\blacktriangledown$  and  $\blacktriangle$  buttons and the  $\text{P}$  button to move between digits, to enter the required indicator display at the first break-point. When set as required, press  $\text{E}$  to return to the 0:n prompt from which the next break-point can be selected using the  $\blacktriangledown$  or  $\blacktriangle$  button. When the required break-point has been selected press  $\text{P}$  and set the required indicator display at this break-point.

Repeat this procedure until the indicator display at all the break-points has been defined and then return to the 5EL function in the configuration menu by pressing the  $\text{E}$  button twice.

#### Error message

**If during calibration the indicator displays a FR, L error message the current at which the selected break-point is being set is not above the preceding break-point or is not below the following break-point.**

### 7.2.1 Example

#### Adding break-points to a new indicator

When adding break-points to a new indicator, or to a lineariser following resetting to the factory defaults using the r5EL function described in section 6.11, each additional break-point should be added before the highest existing breakpoint. The first additional break-point should be added before the default break-point 1:1 which will result in a display of 1:2. If more new break-points are required, using the  $\blacktriangle$  button select the new highest break-point 2:2 and add the second additional break-point by operating the  $\text{P}$  push button which will result in a display of 2:3. Repeat the sequence until the required number of break-points has been entered.

### 7.3 Under and over-range

The lineariser does not change the under and over-range indication described in section 6.12. At input currents below that specified for the first break-point 0:n, the indicator will continue to use the specified slope of the first segment.

At input currents above that specified for the last break-point n:n, the indicator will continue to use the slope specified for the last lineariser segment.

### 7.4 Lineariser default configuration

When the lineariser is reset to the factory defaults using the LELb function described in section 6.11, the defaults conditions are:

		Indicator display	
		BA304SG	BA324SG
First break-point	0:1 4mA	0.0	0.00
Second break-point	1:1 20mA	100.0	100.00

## 8. MAINTENANCE

### 8.1 Fault finding during commissioning

If an indicator fails to function during commissioning the following procedure should be followed:

Symptom	Cause	Solution
No display	Incorrect wiring	Check wiring  There should be 2.0 to 5.3V between terminals 1 & 3 with terminal 1 positive.  With an optional backlight there should be 5.8 to 9.1V between terminals 1 & 3 with terminal 1 positive.
No display 0V between terminals 1 & 3.	Incorrect wiring or no power supply	Check supply voltage and voltage drop caused by all the instruments in the loop.
All decimal points flashing.	Overrange or underrange if -ve sign is displayed.	Recalibrate the numerical display.
Unstable display	4/20mA input is noisy.	Eliminate ripple on 4/20mA power supply and/or decrease indicator resolution.
Indicator displays LFL	4/20mA input is too low.	Measure 4/20mA current and ensure that it is above 3mA.
Unable to enter configuration menu.	Incorrect security code entered.	Enter correct security code, or contact BEKA if the code has been lost.

### 8.2 Fault finding after commissioning

#### ENSURE PLANT SAFETY BEFORE STARTING MAINTENANCE

**The BA304SG and BA324SG are Ex eb and Ex tb certified indicators. The instrument enclosure should only be opened when the indicator is de-energised, or a gas/dust clearance certificate has been issued.**

If an indicator fails after it has been functioning correctly, follow the procedure shown in section 8.1. If this does not reveal the cause of the fault, it is recommended that the instrument is replaced.

### 8.3 Servicing

BA304SG and BA324SG loop powered indicators are interchangeable. A single spare instrument assembly may quickly be recalibrated to replace any instrument that is damaged or fails. No attempt should be made to repair instruments at component level.

**We recommend that faulty instruments are returned to BEKA associates or to your local BEKA agent for repair.**

### 8.4 Routine maintenance

The mechanical condition of the instrument and electrical calibration should be regularly checked. The interval between inspections depends upon environmental conditions.

### 8.5 Guarantee

Indicators which fail within the guarantee period should be returned to BEKA associates or our local agent. It is helpful if a brief description of the fault symptoms is provided.

### 8.6 Customer comments

BEKA associates is always pleased to receive comments from customers about our products and services. All communications are acknowledged and whenever possible, suggestions are implemented.

## 9. ACCESSORIES

### 9.1 Units of measurement & instrument identification.

New indicators are supplied with a printed scale card showing the units of measurement and tag information specified when the instrument was ordered. If this information was not supplied a blank scale card will be supplied which can easily be marked on-site with a dry transfer or a permanent marker.

Custom printed scale cards are available as accessories and may be easily fitted as shown in section 5.7 of this manual.

All models can also be supplied with a blank or custom laser engraved stainless steel legend plate - see Fig 7. The plate, which after installation is visible from the front of the instrument, is supplied loose with two fixing screws for securing it to the rear of the instrument's back-box. This plate can typically accommodate:

- 1 row of 5 alphanumeric characters 10mm high
- or 1 row of 6 alphanumeric characters 7mm high
- or 2 rows of 10 alphanumeric characters 5mm high

### 9.2 Display backlight

Both models can be supplied with a factory fitted loop powered backlight which produces green background illumination enabling the display to be read at night or in poor lighting conditions. When fitted the indicator's voltage drop at 20mA increases to 9.1V.

### 9.3 Pipe mounting kit

The BA393G is a 316 stainless steel kit which will secure an indicator to a horizontal or vertical pipe with an outside diameter between 40 and 73mm.

Detailed assembly instructions are supplied with each BA393G pipe mounting kit.

### 9.4 Panel mounting kit

The BA394G panel mounting kit, which consists of two 316 stainless steel brackets, will secure an indicator into a panel aperture. The kit does not seal the joint between the panel and the instrument and is intended for mounting an indicator onto an open panel.

## APPENDIX 1

### Dust Certification

#### A1.0 Ex tb dust certification

In addition to IECEx, ATEX & UKEX certification permitting installation in explosive gas atmospheres, which is described in the main section of this instruction manual, both models have IECEx, ATEX & UKEX dust ignition protection by enclosure Ex tb.

Dust ignition protection by enclosure Ex tb is a type of explosion protection in which electrical equipment is mounted in an enclosure that provides dust ingress protection, and limits the enclosure surface temperature allowing installation in Zones 1 and 2.

#### A1.1 Zones, and Maximum Surface Temperature

Both indicators have Ex ib mb tb IIIC T80°C Db -40°C ≤ Ta ≤ +60°C certification. When connected to a suitable system the indicators may be installed in:

- |         |  |
|---------|--|
| Zone 21 | explosive atmosphere in the form of a cloud of combustible dust in air is likely to occur occasionally in normal operation.  |
| Zone 22 | explosive atmosphere in the form of a cloud of combustible dust in air is not likely to occur in normal operation, but if it does occur, will only persist for a short period. |

Be used with dust in subdivisions:

- |      |                     |
|------|---------------------|
| IIIA | combustible flyings |
| IIIB | non-conductive dust |
| IIIC | conductive dust     |

Having a Minimum Ignition Temperature of:

- |   |                      |
|---|----------------------|
| Dust cloud                              | 120°C                |
| Dust layer on indicator up to 5mm thick | 155°C                |
| Dust layer on indicator over 5mm thick. | Refer to EN 60079-14 |

At an ambient temperature between -40 and +60°C

**Note:** Types of explosion protection on both certificates are listed in alphabetical order.

**A1.2 Installation and maintenance**

The installation requirement described in this manual for use in potentially explosive gas atmospheres also apply when the indicators are installed in a potentially combustible dust atmosphere.

The instrument enclosure should only be opened when the indicator is de-energised and dust can not enter the instrument enclosure. Before replacing the indicator assembly the sealing gasket should be inspected to ensure that it is undamaged and free from foreign bodies.

It is good practice to prevent dust accumulating on the indicator enclosure. If this can not be avoided, care should be taken to ensure that the layer thickness does not exceed 5mm for dusts having a minimum ignition temperature of 155°C.

**A1.3 Cable glands and conduit fittings**

Both back-box cable entries have M20 x 1.5 threads. The right hand entry is fitted with an Ex e and Ex t certified stopping plug and the left hand entry with a temporary plug to prevent the ingress of dust and dirt during transportation.

Certified Ex t plastic or metallic cable glands or conduit entries should be used. If two armoured cables are used, the armour on each cable should be earthed.